


COMPONENTS FUNCTION LOCATION CONTACTS

1MC	MOTOR CONTACTOR	13	1,2,3
1DS	MOTOR PROTECTOR	1,2,3	
1PS	PRESSURE SWITCH	18	
1SW	HAND/OFF/AUTO SELECTOR SW.	13	

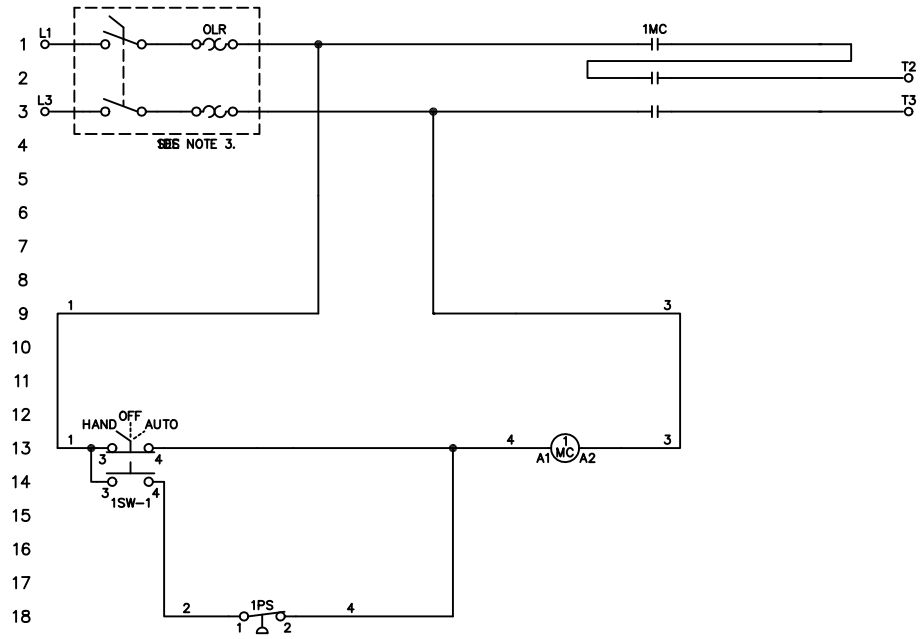


NOTES FOR FIELD WIRING:

1) USE COPPER WIRING ONLY EXCEPT AT TERMINALS MARKED CU-AL,

2) TO REDUCE THE RISK OF FIRE, REPLACE WITH SAME TYPE AND RATING AS FUSE ORIGINALLY INSTALLED.

3) 3FU NOT SUPPLIED ON 115V 1 PHASE UNITS.

DRAWN	SR	3-1-95	 METRON, INC. DENVER, CO.
CHECK	x.s.	3-1-95	
APPD	RL	3-1-95	
SCHEMATIC, MODEL M15B, SINGLE PHASE WITH MOTOR PROTECTOR SWITCH JOCKEY PUMP CONTROLLER, W/O XFMR.			CS32277C SCALE N.T.S. SHEET 1 OF 1